

**SAFETY DEFECT/NONCOMPLIANCE NOTICES**  
**RECEIVED DURING JANUARY 2013**

*Published February 6, 2013*

**CHILD SEATS:**

None during January 2013.

**EQUIPMENT:**

Ricon is recalling certain S series and K Series wheelchair lifts manufactured after August 1, 2006, and equipped with an optional armored pendant cable. The cable may have been installed such that it doesn't clear the wheelchair lift and without a protective cover, or a misinstalled protective cover. The cable may contact the power lug at the base of the wheel chair lift causing a short circuit that could result in a fire. Ricon will notify the affected vehicles manufacturers and will provide a supplemental cover kit and instructions, free of charge. This recall campaign began during February 2013. Owners may contact Ricon at 1-818-267-3000.

**13E-001**

Hayes Lemmerz International Commercial Highway, Inc. (Hayes Lemmerz), is recalling certain commercial steel wheels, model 10073 with date codes ending in A030912 and B030912. These wheels were sold as aftermarket/replacement equipment or installed as original equipment on various commercial highway vehicles (highway tractor, truck, trailer and bus applications). Due to an inadequate weld between the wheel disc and rim, the disc can separate from the rim. Separation of the rim and tire from the vehicle can result in a loss of control and a vehicle crash. Hayes Lemmerz will notify affected aftermarket/replacement wheel distributors and vehicle manufacturers. The vehicle manufacturers will notify owners of vehicles that may have had the affected wheels installed as original equipment. The recall began in January 2013. Vehicle owners should contact their vehicle manufacturer and owners of the aftermarket wheels should contact their aftermarket distributor. For further information and questions, Hayes Lemmerz may be contacted at 1-734-737-5205. This recall is a supersession of recall 12E-044.

**13E-002**

Vision Wheel is recalling certain Prado model after-market wheels; style numbers 901, 902, and 903. The affected wheels may fracture during normal use. A fractured wheel may cause a loss of tire air pressure which may lead to tire failure or the loss of vehicle control. Either scenario may increase the risk of a crash. Vision Wheel will notify owners and distributors, and offer replacement, wheels free of charge. The recall is expected to begin in early February 2013. Owners may contact Vision Wheel at 1-800-633-3936.

**13E-003**

Rigid Hitch Inc. is recalling certain Heavy Duty Utility Bar hitches with the part number HUB-3208. The affected 2" bars drop 8" between hole centers and are stamped 33411-04812 near the weld line. Due to an incorrect welder placement, the weld penetration may be insufficient, causing the utility bar to crack and fail. If the utility bar fails while in use, whatever is being towed may come loose increasing the risk of a crash. Rigid Hitch will notify distributors and all known owners and replace the parts free of charge. The recall is expected to begin in early February 2013. Customers may contact Rigid Hitch at 1-800-624-7630.

**13E-004**

Fram Group Operations, LLC (Fram) is recalling certain Subaru original service equipment oil filters sold for

**SAFETY DEFECT/NONCOMPLIANCE NOTICES**  
**RECEIVED DURING JANUARY 2013**

*Published February 6, 2013*

installation on Subaru Legacy, Outback, Impreza, and Forester model vehicles equipped with certain 4 cylinder engines. Due to manufacturing anomalies, upon engine start up, engine oil may leak from around the oil filter gasket, causing a rapid loss of nearly all engine oil. Oil on hot engine or exhaust surfaces can result in smoke and possibly a fire. Fram will replace the defective oil filters free of charge. Owners may contact Fram at 1-800-890-2075, Option 2, or go to [www.fram.com/Subaru\\_recall](http://www.fram.com/Subaru_recall) for more information.

**13E-005**

**TIRES:**

Continental Tire is recalling certain ContiMotion motorcycle tires, size 180/60R16 M/C 74H produced from December 19, 2010, through September 24, 2011. The tires were sold as replacement equipment for Honda GoldWing 1800 motorcycles. Some of these tires may experience uneven wear, groove cracking, and belt lift. This could result in a loss of inflation pressure. A loss of inflation pressure while riding could cause the motorcycle operator to lose control, increasing the risk of a crash. Continental Tire will notify owners and reimburse customers for the affected tires. The recall is expected to begin during February 2013. Owners may contact Continental Tire customer service toll-free at 1-888-799-2168.

**13T-001**

**VEHICLES:**

General Motors (GM) is recalling certain model year 2013 Cadillac Escalade, Escalade ESV, and Escalade EXT; Chevrolet Avalanche, Express, Silverado HD, Silverado LD, Suburban, and Tahoe; and GMC Savana, Sierra HD, Sierra LD, Yukon, and Yukon XL vehicles, manufactured between November 7, 2012, through December 18, 2012, for failing to comply with the requirements of Federal Motor Vehicle Safety Standard (FMVSS) No. 102, "Transmission Shift Lever Sequence, Starter Interlock, and Transmission Braking Effect", and FMVSS No. 114, "Theft Protection and Rollaway Prevention." The vehicles may have been built with a fractured park lock cable or a malformed steering column lock actuator gear in the lock module assembly. As a result, the vehicle may shift from Park with the ignition key removed or the ignition key in the OFF position. The vehicle may also shift out of Park without application of the brake pedal while the key is off. Either of these scenarios may cause the vehicle to roll away after the driver has exited the vehicle, resulting in a possible vehicle crash and/or injury. GM will notify owners, and dealers will inspect the affected vehicles and replace the steering column as necessary, free of charge. The recall began on January 21, 2013. Chevrolet owners may call 1-800-630-2438. Cadillac owners may call 1-866-982-2339. GMC owners may call 1-866-996-9463. General Motors' number for this recall is 12331.

**13V-001**

Temsa Global is recalling certain model year 2012-2013 TS30 motorcoaches manufactured from November 2011, through December 2012. When the vehicle is put in the "body lift" position, the brake hoses near the front tires become stretched. After repeated use of the "body lift" function, the brake hoses may leak air reducing the braking force of the front brake system, increasing the risk of a crash. Temsa will notify owners, and dealers will install longer front brake hoses, free of charge. The recall is expected to begin during February 2013. Owners

**SAFETY DEFECT/NONCOMPLIANCE NOTICES**  
**RECEIVED DURING JANUARY 2013**

*Published February 6, 2013*

may contact Temsa at 1-404-602-0151.

**13V-002**

Polaris is recalling certain model year 2010-2013 Global Electric Motorcars manufactured from January 14, 2010, through November 23, 2012. The parking brake has mechanical components which may wear prematurely and prevent the brake from engaging. If the parking brake fails to engage while parking, the driver may not be able to prevent the vehicle from rolling away after exiting the vehicle, increasing the risk of a vehicle crash. Polaris will notify owners and dealers will replace the parking brake lever assembly free of charge. The safety recall began on January 29, 2013. Owners may contact Polaris customer service by calling 1-888-704-5290. Polaris' recall numbers are L-13-01 and L-13-02.

**13V-003**

ARBOC specialty vehicles, LLC (ARBOC) is recalling certain model year 2012 Spirit of Mobility buses, models 21-G, 23-G, 23-D, 26-G, 26S-DC, 26-D, 28-G and 28-GC, manufactured from May 14, 2012, through September 26, 2012. The passenger seat base rear bolts may be missing their reinforcement plates. In the event of an accident, inadequate reinforcement of the passenger seat may result in the seats ripping from the floor, increasing the risk of injury to the vehicle occupants. ARBOC will notify owners, and dealers will repair the affected seat bases, free of charge. This recall began on January 14, 2013. Owners may contact ARBOC at 1-575-825-4880.

**13V-004**

Forest River is recalling certain model year 2010-2012 Berkshire and Charleston diesel motorhomes. The chassis are equipped with connectors for diode jumpers that may come loose, resulting in an open circuit. Two circuits are affected: The one that disengages the cruise control with brake pedal use, and the one that illuminates the brake lights with brake pedal use. Failure of the cruise control to disengage when the brakes are applied may increase the risk of a vehicle crash. Without the brake lights illuminating when the brakes are applied, the driver's intent is not communicated, increasing the risk of a crash. Daimler Truck North America (DTNA) is performing this recall on behalf of Forest River. DTNA will notify owners, and dealers will inspect the diode jumpers to make sure they are fully locked in place and will correct the vehicles as needed. The recall began in January 2013. Owners should contact Daimler Trucks Warranty Campaigns Department at (800) 547-0712, 7:00 a.m. to 4:00 p.m. Pacific Time Monday through Friday, e-mail address [DTNA.Warranty.Campaigns@Daimler.com](mailto:DTNA.Warranty.Campaigns@Daimler.com), or the Customer Assistance Center at (800) FTL-HELP after normal business hours.

**13V-005**

Autocar Industries, LLC is recalling certain model year 2012 Xpert vehicles manufactured October 17, 2011, through September 17, 2012; and with serial numbers in the range 213522 through 215336. The seat belt anchorages fail to sustain the 3000 pound forces for the specified length of time. Therefore, these vehicles fail to conform to the requirements of Federal Motor Vehicle Safety Standard No. 210, "Seat Belt Assembly Anchorages." In the event of a crash, an insufficient seat belt anchorage may prevent the seat belt from properly restraining the occupant. This increases the risk of injury to the seat occupant. Autocar will notify owners, and dealers will repair the seat belts, free of charge. The recall is expected to begin on March 1, 2013. Owners may contact Autocar at 1-765-489-5499. Autocar's recall campaign number is M-1208.

**SAFETY DEFECT/NONCOMPLIANCE NOTICES**  
**RECEIVED DURING JANUARY 2013**

*Published February 6, 2013*

**13V-006**

Fleetwood RV is recalling certain model year 2012 and 2013 Bouncer Classic model 30T motorhomes manufactured from February 17, 2012, through November 30, 2012. The Federal Certification Tag information relating to front and rear tires is incorrect. Due to the inaccurate label, these vehicles fail to comply with the requirements of Part 567, "Certification." Owners relying on the information provided on the label may incorrectly inflate their tires, which could contribute to a tire failure that could cause a crash. Fleetwood RV will mail new federal certification tags to owners. Owners who are not comfortable installing these labels may have them replaced at a dealer, free of charge. The safety recall began on January 31, 2013. Owners may contact Fleetwood RV Owner Relations at 1-800-509-3418.

**13V-007**

Goshen Coach is recalling certain buses as follows: GC II, model years 2006-2012; GCII-550, model years 2007-2009; G-Force, model years 2011-2012; Pacer, model years 2006-2012; Pacer LS, model years 2008, 2010, and 2013; Pacer LTD, model year 2012; and Sentinel, model year 2011. The buses are equipped with a Ricon manufactured wheelchair lift which has an optional armored pendant cable. The cable may have been installed such that it doesn't clear the wheelchair lift and without a protective cover, or a misinstalled protective cover. The cable may contact the power lug at the base of the wheel chair lift causing a short circuit that could result in a fire. Goshen Coach is working with Ricon to notify owners. Ricon will provide a supplemental cover kit with instructions, free of charge. Owners may contact Goshen Coach at 1-574-970-6300 or Ricon at 1-818-267-3000.

**13V-008**

Eldorado National is recalling certain model year 2012 Aerotech 240 buses manufactured May 2012, through October 2012. The affected buses are equipped with a Ricon manufactured wheelchair lift which has an optional armored pendant cable. The cable may have been installed such that it doesn't clear the wheelchair lift and without a protective cover, or a misinstalled protective cover. The cable may contact the power lug at the base of the wheel chair lift causing a short circuit that could result in a fire. Eldorado National is working with Ricon to notify owners. Ricon will provide a supplemental cover kit with instructions, free of charge. Owners may contact Eldorado National at 1-785-827-1033 or Ricon at 1-818-267-3000.

**13V-009**

General Motors (GM) is recalling certain model year 2013 Chevrolet Express vehicles manufactured November 1, 2012, through December 21, 2012; and model year 2013 GMC Savana vehicles, manufactured November 14, 2012, through November 20, 2012. It may be possible to remove the key from the ignition when the vehicle is running or the transmission is not in the Park position. As such, these vehicles fail to conform to the requirements of Federal Motor Vehicle Safety Standard 114, "Theft Protection." If the ignition key is removed while the vehicle is still on and/or the vehicle is not in Park, the vehicle may rollaway and the unintended movement of the vehicle may result in a possible crash or injury to pedestrians. GM will notify owners, and dealers will replace the ignition lock cylinder and the two associated keys. This service will be performed free of charge. The recall began on February 8, 2013. For more information, GMC owners may call 1-866-996-9463 and Chevrolet owners may call 1-800-630-2438. General Motors' safety recall number is 12332.

**SAFETY DEFECT/NONCOMPLIANCE NOTICES**  
**RECEIVED DURING JANUARY 2013**

*Published February 6, 2013*

**13V-010**

North American Bus Industries Inc. (NABI) is recalling certain model year 2007-2009 Blue Bird L4RE transit buses manufactured July 1, 2007, through October 31, 2009. The buses may have a defective steering gear attachment. Cracks may develop in the bracket that secures the power steering gear to the bus frame or the bus frame may crack around the bolts that attach the steering gear bracket to the frame. If left unchecked, the cracks may propagate and cause partial separation of the steering gear from the bus frame. This would cause a loss of steering control, increasing the risk of a vehicle crash. NABI will notify owners, and dealers will inspect and repair the buses free of charge. The recall is expected to begin in March 2013. Owners may contact NABI at 1-256-831-4296.

**13V-011**

Braun is recalling certain model year 2011-2013 Rampvan vehicles manufactured from May 8, 2012, through January 3, 2013. Braun Rampvans are Toyota Sienna minivans that have been modified for special use. The Braun-specific toe panel comes in close proximity to the accelerator pedal lever. There could be an interference of the toe panel and the accelerator pedal lever. If there is interference, the pedal may not return to the idle position which may produce unintended acceleration. This could increase the risk of a vehicle crash. Braun will notify owners, and Braun dealers will modify the toe panel plastic as needed, free of charge. The recall will begin in February 2013. This recall is being conducted by Braun and not by Toyota. Owners may contact Braun customer service center at 1-800-488-0359.

**13V-012**

Entegra Coach is recalling certain model year 2013 Aspire Class A motorhomes manufactured April 11, 2012, through August 30, 2012. On the affected vehicles, the Certification label incorrectly identifies the size of the tires on the rear axles. Thus, these vehicles fail to comply with the requirements of Federal Motor Vehicle Safety Standard No. 120, "Tire Selection and Rims for Motor Vehicles Other Than Passenger Cars." An inaccurate label could lead to installation of improper replacement tires which may cause vehicle overloading which could lead to a tire failure resulting in personal injury or property damage. Entegra Coach will notify owners and dealers will replace the Certification label. The recall is expected to begin during February 2013. Owners may contact Entegra Coach at 1-800-945-4787.

**13V-013**

Southeast Toyota Distributors, LLC (SET) is recalling certain models interspersed through model years 2009 through 2013 as follows: model year 2009-2012 Tacoma, 4Runner, Camry, Camry Hybrid, Prius, and RAV4; model year 2009-2010 Avalon, FJ Cruiser, and Highlander Hybrid; model year 2010-2013 model year Corolla, Sienna and Tundra; model year 2009-2013 Highlander and Venza; model year 2012 Prius V; and model year 2010-2012 Sequoia. During modification by SET to include accessories such as leather seat covers, seat heaters or headrest DVD systems, these vehicles may not have had the passenger seat occupant sensing system calibration tested. Without passing the calibration test, the occupant sensing system may not operate as designed. If the front passenger seat occupant sensing system is out of calibration, the front passenger airbags may not deploy or they may deploy inappropriately for the passenger's size and position. This could increase the risk of personal injury during the event of a vehicle crash necessitating airbag deployment. Southeast Toyota will

**SAFETY DEFECT/NONCOMPLIANCE NOTICES**  
**RECEIVED DURING JANUARY 2013**

*Published February 6, 2013*

notify owners, and dealers will test the sensitivity of the occupant detection sensors, and recalibrate them as necessary. The recall is expected to begin during February 2013. Owners may contact Southeast Toyota at 1-800-301-6859.

**13V-014**

Prevost is recalling certain model year 2010-2013 H3 and X3 coaches and MTH XLII-45E coach shells manufactured between June 29, 2009, up to June 4, 2012, and equipped with an Automatic Fire Detection and Suppression System (AFSS). There is the possibility that the AFSS could unintentionally activate due to wear of the linear thermal detection cable. An activation of the AFSS causes the vehicle to come to an unplanned stop. This could increase the risk of a vehicle crash or personal injury. Prevost will notify owners, and dealers will inspect and repair the linear thermal detector by adding a protective sheath, free of charge. The recall is expected to begin during February 2013. Owners may contact Prevost at 1-418-883-2888 x 6558. Prevost's campaign recall number is SR13-03.

**13V-015**

Honda is recalling certain model year 2009-2013 Pilot and 2011-2013 Odyssey passenger vehicles manufactured from March 13, 2008, through December 21, 2012. One or more rivets that attach the airbag module to the airbag cover may be missing. The absence of more than one rivet could alter the performance of the driver's airbag during deployment. This could potentially increase the risk of injury during a crash. Honda will notify owners and instruct them to take their vehicle to a Honda dealer. The dealer will inspect the driver's airbag module and replace it if necessary, free of charge. The recall is expected to begin on, or about, February 16, 2013. Owners may contact Honda at 1-800-999-1009. Honda's recall campaign number is S75.

**13V-016**

BMW is recalling certain model year 2011 1-Series ActiveE passenger vehicles manufactured August 17, 2011, through December, 19, 2011. Due to an insufficient sealing of the drivetrain housing assembly there may be a lack of grease lubrication on the gear shaft that transfers power from the electric motor to the transmission. Over time, the connection between the electric motor and the transmission may wear, possibly resulting in a sudden loss of vehicle propulsion. This could increase the risk of a vehicle crash. BMW will notify owners by telephone, and dealers will inspect the drivetrain connection and update the sealing system. Any worn electric motor gearing will be replaced. The recall is expected to begin in February 2013. Owners may call BMW at 1-800-525-7417 or email BMW at CustomerRelations@bmwusa.com.

**13V-017**

Great Dane Trailers is recalling certain model year 2013 Dry Freight Semi-Trailers. The axle nut retaining clips may not have been properly seated. Disengagement of the axle nut retaining clips could lead to excessive wheel end play and/or wheel separation. Great Dane Trailers is recalling certain model year 2013 Dry Freight Semi-Trailers. The axle nut retaining clips may not have been properly seated. Disengagement of the axle nut retaining clips could lead to excessive wheel end play and/or wheel separation. Great Dane will notify owners, and dealers will inspect the axle nut retaining clips and correct their installation as necessary, free of charge. The recall is expected to begin during February 2013. Owners may contact Great Dane customer service at 1-877-369-3493.

**SAFETY DEFECT/NONCOMPLIANCE NOTICES**  
**RECEIVED DURING JANUARY 2013**

*Published February 6, 2013*

**13V-018**

Navistar is recalling certain model year 2013 IC brand CE buses, and 2012-2013 RE buses; manufactured from December 7, 2010, through June 26, 2012 and equipped with model year 2011 through 2013 I-6 engines and feature codes 12NUK, 12NUL, 12NUM, 12NUN, 12NUP and 12NUS. The injection pressure regulator (IPR) harness wire may break due to vibrational damage. This could cause an unexpected shut down of the engine. An unexpected engine shut down while driving may increase the risk of a vehicle crash. Navistar will notify owners, and dealers will replace the IPR wire connector, free of charge. The safety recall is expected to begin by March 18, 2013. Owners may contact Navistar at 1-800-448-7825. Navistar's recall campaign number is 13502.

**13V-019**

Navistar is recalling certain model year 2012-2013 IC Bus brand model 1300FBC, CE, HC, and RE buses; model year 2011-2013 International brand model Durastar, model year 2013 International brand Workstar trucks; model year 2013 Holiday Rambler brand model Ambassador and Endeavor vehicles; and model year 2013 Monaco brand model Diplomat and Knight vehicles. These vehicles were manufactured August 5, 2010 through September 6, 2012 and are equipped with certain 2011-2013 model year I-6 engines with feature codes 12NUK, 12NUL, 12NUM, 12NUN, 12NUP, 12NUR, 12NUS, 12NUT, 12NUU, 12NUV, 12NUX, 12NUY and 12NUZ. The injection pressure regulator (IPR) harness wire may break due to vibrational damage. This could cause an unexpected shut down of the engine. An unexpected engine shut down while driving may increase the risk of a vehicle crash. Navistar will notify owners, and dealers will replace the IPR wire connector free of charge. The safety recall is expected to begin by March 18, 2013. Owners may contact Navistar at 1-800-448-7825. Navistar's recall campaign number is 13501.

**13V-020**

Prevost is recalling certain model year 2013 X3-45, H3-45, and XLII-45 Entertainer coach buses and coach bus shells manufactured September 25, 2012, through November 29, 2012 for failing to conform to the requirements of Federal Motor Vehicle Safety Standard (FMVSS) number 108, "Lamps, Reflective Devices, and Associated Equipment." The buses may have missing side reflectors. The absence of reflectors could reduce the ability for others to see the bus, increasing the risk that another vehicle may crash into the bus. Prevost will notify owners, and dealers will add side reflectors, free of charge. The recall is expected to begin during February 2013. Owners may contact Prevost at 1-418-883-2888 x 6558. Prevost's campaign recall number is SR13-05.

**13V-021**

Daimler Trucks North America (DTNA) is recalling certain model year 2013-2014 Thomas Built Buses brand Saf-T-Liner EFX school buses manufactured from March 29, 2012, through November 14, 2012 and equipped with 100% Daytime Running Lights (DRL) option code C3676-24-000. The DRL circuit breaker may trip during continuous operation of the headlights in high beam mode. This would result in a loss of power to the headlights, marker lights, tail lights, and dash lighting. A loss of power to the bus' lights may reduce the driver's ability to see other vehicles, pedestrians, or objects, as well as reduce the bus' visibility to other drivers or pedestrians, increasing the risk of crash. DTNA has notified the affected owners. Dealers will replace the circuit

## **SAFETY DEFECT/NONCOMPLIANCE NOTICES**

**RECEIVED DURING JANUARY 2013**

*Published February 6, 2013*

breaker, free of charge. The recall began on December 14, 2012. Owners may contact DTNA at 1-800-547-0712. DTNA's recall campaign number is FL-638.

**13V-022**

General Motors is recalling certain model year 2012 Chevrolet Camaro, Buick Verano, Chevrolet Cruze, and Chevrolet Sonic vehicles. The driver side frontal air bag has a shorting bar which may intermittently contact the air bag terminals. If the bar and terminals are contacting each other at the time of a crash necessitating deployment of the driver's frontal airbag, that airbag will not deploy, increasing the driver's risk of injury. General Motors will notify owners, and dealers will replace the steering wheel airbag coil, free of charge. The safety recall is expected to begin on February 13, 2013. Owners may contact General Motors at 1-800-521-7300. This is General Motors recall number 12261 and is an expansion of NHTSA recall 12V-522.

**13V-023**

General Motors is recalling certain model year 2013 Chevrolet Malibu vehicles, manufactured December 6, 2011, through January 15, 2013. One or more rear suspension bolts may not have been tightened to the specified torque. This may lead to sudden changes in vehicle handling. Sudden changes in vehicle handling may increase the risk of a crash. General Motors will notify owners, and dealers will inspect and retighten the bolts as necessary, free of charge. Owner notifications have already begun and will be completed shortly. Owners may contact General Motors at 1-800-521-7300. This is General Motors recall number 13008.

**13V-024**

Stoughton Trailers is recalling certain model year 2009-2011 AHV grain hauler/ag hopper trailers produced December 17, 2007, through October 28, 2010. These trailers may develop fatigue cracks in the lower rail of the frame structure and/or in the front attachment of the suspension subframe channels. Structural cracks could eventually compromise the structure and lead to failure. This could result in a loss of vehicle control, increasing the risk of a crash. Stoughton Trailers will notify owners and will replace the suspension subframe front attachments as well as the crossmember assembly forward of the front hopper, free of charge. The recall is expected to begin by April 2013. Owners may contact Stoughton Trailers at 1-608-873-2500.

**13V-025**

Dutchmen is recalling certain model year 2007-2011 Grand Junction; model year 2008-2009 Victory Lane and Winners Circle; model year 2009-2010 N'Tense; model year 2010 Freedom Spirit and model year 2009 Monte Vista recreational trailers. The affected trailers are equipped with Iota ITS-50R transfer switches. Wiring connections inside the transfer switch are not adequate and, as a result, the switch may overheat. An overheated switch could result in a fire. Dutchmen will notify owners and replace the Iota transfer switch, free of charge. The safety recall is expected to begin in February 2013. Owners may contact Dutchmen at 1-574-537-0700.

**13V-026**

PACCAR is recalling certain model year 2013 Kenworth T680 vehicles, manufactured from November 29, 2012, through December 6, 2012; and model year 2013 Peterbilt 579 and 567 vehicles, manufactured from August 28, 2012, through December 31, 2012. These vehicles were equipped with the air suspension dump valve option. New software may cause the rear air suspension to re-inflate without warning when the operator



**SAFETY DEFECT/NONCOMPLIANCE NOTICES**  
**RECEIVED DURING JANUARY 2013**

*Published February 6, 2013*

turns the ignition key to the "off" position. An unexpected re-inflation of the suspension could result in personal injury to a person near the rear suspension. PACCAR will notify owners, and dealers will reprogram the software. The recall will begin during February 2013. Owners may contact Kenworth at 1-425-828-5000 or Peterbilt at 1-940-591-4000. Kenworth's recall campaign number is 13KWA. Peterbilt's recall campaign number is 113-A.

**13V-027**

Entegra Coach is recalling certain model year 2011-2013 Aspire and Anthem Class A motorhomes; and 2012-2013 Cornerstone Class A motorhomes, manufactured March 14, 2011, through September 25, 2012. A wiper link was installed which is shorter than required for proper function of the wiper system. The wipers may not operate as designed and the driver's visibility can be reduced, increasing the risk of a crash. Entegra Coach will notify owners and dealers will replace the wiper link, at no charge. The recall is expected to begin during February 2013. Owners may contact Entegra Coach at 1-800-945-4787.

**13V-028**

Toyota is recalling certain model year 2003-2004 Corolla and Corolla Matrix vehicles and 2003-2004 Pontiac Vibe vehicles. The supplemental restraint system (SRS) circuits are susceptible to internal shorting. The electrical short may create an abnormal current flow and increased heat which can damage the circuits. This could result in an inadvertent deployment of the front airbags and/or seat belt pretensioners. Inadvertent deployment of the airbags or the seat belt pretensioners may increase the risk of injury and the possibility of a vehicle crash. Toyota will notify their owners, and General Motors will notify theirs. Dealers will install a supplemental harness containing an electrical filter between the airbag control module and its wire harness, free of charge. A notification schedule has not been provided. For more information, Toyota owners may call 1-800-331-4331 and Pontiac owners may call 1-800-620-7668.

**13V-029**

Toyota is recalling certain model year 2006-2012 Lexus IS250 and IS350 vehicles manufactured August 23, 2005, through October 5, 2011; 2010-2012 Lexus IS250C and IS350C vehicles manufactured April 10, 2009, through October 6, 2011; and 2008-2011 Lexus IS-F vehicles manufactured December 14, 2007, through July 10, 2011. The nuts that fasten the wiper arms may be insufficiently torqued such that if the wiper arms are restricted by an external load, such as a buildup of heavy snow, one or both of the wipers may become inoperative. Inoperative wipers could reduce driver visibility and increase the risk of a vehicle crash. Toyota will notify owners, and Lexus dealers will install new wiper arm nuts, free of charge. The recall will begin in late February 2013. Owners may contact Toyota at 1-800-331-4331.

**13V-030**

Mitsubishi Motors North America is recalling certain model year 2012 i-MiEV electric vehicles manufactured December 2, 2011, through September 7, 2012. The brake system vacuum pump may fail, causing the vacuum pump to be inoperable. If the vacuum pump system fail, it will reduce available brake power which would result in lengthened stopping distances, which may increase the risk of a vehicle crash. Mitsubishi will notify owners, and dealers will replace the affected vacuum pumps free of charge. The manufacturer has not yet provided a notification schedule. Owners may contact Mitsubishi at 1-888-648-7820. Mitsubishi's campaign recall

**SAFETY DEFECT/NONCOMPLIANCE NOTICES**  
**RECEIVED DURING JANUARY 2013**

*Published February 6, 2013*

number is SR-13-001.

**13V-031**

Triumph Motorcycles (Triumph) is recalling certain model year 2011-2012 Daytona 675 and Street Triple motorcycles and 2012 Thunderbird and Thunderbird Storm motorcycles. The wheels were assembled with bearings of an unknown quality. Wheel bearings of poor quality could fail unexpectedly, increasing the risk of a motorcycle crash. Triumph will notify owners, and dealers will replace the affected bearings free of charge. Owners may contact Triumph at 1-678-854-2010 for more information.

**13V-032**

Wilson Trailer Company (Wilson Trailer) is recalling certain model year 2010-2013 livestock trailers manufactured from August 1, 2009, through November 30, 2012 and equipped with a lift deck in the nose compartment. The plastic deck guides on the lift deck in the nose compartment can fail to provide proper tracking of the deck when it is raised and lowered. Failure of these guides to provide containment could allow the lift deck to shift to one side causing the deck to fall past the permanent deck support rails, increasing the risk of damage to property inside the trailer. Wilson Trailer will notify owners, and dealers will repair the trailers free of charge. The recall is expected to begin during February 2013. Owners may contact Wilson Trailer at 1-800-798-2002.

**13V-034**